



小零件/磁铁

磁铁 圆型



型号(①代码·②D) — ③L
 EAHNN3 — 3
 EAHN8 — 5

■ 请按步骤①~③选择型号和参数后进行订购。





型号区分: 7天发货
 代码


圆型



镀镍

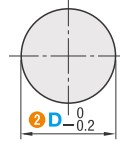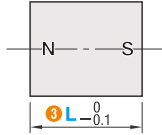

磁化方向: 厚度方向



代码	材质	表面处理	耐热温度
EAHNN	强力钕磁铁	镀镍	60°C
EAHN	钕磁铁		80°C
EAHNNH	耐热钕磁铁		150°C
EAHMS	钴磁铁		200°C

① N极划线或点

型号		吸附力 N {kgf}			表面磁通密度 高斯[G]			
① 代码	② D	EAHNN	EAHN EAHNNH	EAHMS	EAHNN	EAHN EAHNNH	EAHMS	
EAHNN (强力钕磁铁)	1	2	0.08 {0.008}	0.06 {0.006}	0.04 {0.004}	1900~2100	1100~1300	900~1100
		3	—	0.07 {0.007}	0.05 {0.005}	—	1200~1400	1000~1200
		5	0.10 {0.010}	0.08 {0.008}	0.06 {0.006}	2100~2300	1300~1500	1100~1300
	2	2	0.77 {0.08}	0.59 {0.06}	0.39 {0.04}	3500~3700	2400~2600	2000~2200
		3	0.90 {0.09}	0.69 {0.07}	0.49 {0.05}	3700~3900	3100~3300	2600~2800
		4	0.93 {0.09}	0.72 {0.07}	—	3700~3900	3400~3600	—
	3	1	1.39 {0.14}	1.07 {0.11}	—	4100~4300	3100~3300	2600~2800
		2	2.04 {0.21}	1.57 {0.16}	—	2700~2900	2000~2400	—
		3	2.55 {0.26}	1.96 {0.20}	1.08 {0.11}	3700~4000	3100~3300	2600~2800
		4	2.93 {0.30}	2.25 {0.23}	1.37 {0.14}	4200~4500	3300~3500	2800~3000
		5	3.06 {0.31}	2.35 {0.24}	1.47 {0.15}	4400~4700	3400~3600	2900~3100
		6	3.60 {0.37}	2.82 {0.29}	1.57 {0.16}	4500~4800	3500~3700	2900~3100
	4	1	—	1.47 {0.15}	—	4600~4800	4100~4300	—
		2	3.69 {0.38}	2.84 {0.29}	—	—	2000~2200	—
		3	4.97 {0.51}	3.82 {0.39}	1.86 {0.19}	4100~4300	3100~3300	2600~2800
4		5.60 {0.57}	4.31 {0.44}	2.55 {0.26}	4200~4500	3600~3800	3100~3300	
5		6.11 {0.62}	4.70 {0.48}	2.94 {0.30}	4500~4800	3800~4000	3200~3400	
8		8.50 {0.87}	6.82 {0.69}	3.14 {0.32}	4800~5100	4000~4200	3400~3600	
10		9.04 {0.92}	6.96 {0.72}	—	5100~5400	4500~4700	—	
10		—	1.45 {0.16}	—	5200~5500	4500~4700	—	
5		2	5.10 {0.52}	3.92 {0.40}	2.65 {0.27}	4100~4300	3100~3300	2600~2800
		3	7.51 {0.77}	5.78 {0.59}	3.82 {0.39}	3500~3700	3000~3200	2500~2700
	4	8.92 {0.91}	6.86 {0.70}	4.61 {0.47}	4200~4500	3800~4000	3200~3400	
	5	9.93 {1.01}	7.64 {0.78}	5.10 {0.52}	4600~4900	4000~4200	3400~3600	
	6	10.57 {1.08}	8.13 {0.83}	5.10 {0.52}	4900~5100	4300~4500	3600~3800	
	8	11.64 {1.19}	8.96 {0.92}	5.39 {0.55}	5100~5400	4300~4500	3600~3800	
	10	12.74 {1.30}	9.80 {1.00}	—	5100~5400	4700~4900	—	
	10	—	9.80 {1.00}	—	5200~5500	4800~5000	—	
	6	2	6.50 {0.66}	5.00 {0.51}	3.33 {0.34}	4200~4500	3800~4000	3200~3400
		3	9.93 {1.01}	7.64 {0.78}	5.10 {0.52}	3100~3400	2900~3100	2400~2600
4		12.48 {1.27}	9.60 {0.98}	6.47 {0.66}	4000~4300	3700~3900	3100~3300	
5		—	10.88 {1.11}	7.25 {0.74}	4600~4900	3900~4100	3300~3500	
6		15.29 {1.56}	11.76 {1.20}	7.84 {0.80}	—	4300~4500	3600~3800	
8		15.34 {1.66}	11.80 {1.28}	—	5100~5400	4400~4600	3700~3900	
10		15.39 {1.69}	11.84 {1.30}	—	5400~5600	4700~4900	—	
10		—	11.84 {1.30}	—	5500~5800	4800~5000	—	
8		2	—	6.66 {0.68}	4.41 {0.45}	—	2400~2600	2000~2200
		3	14.01 {1.43}	10.78 {1.10}	7.45 {0.76}	3500~3800	3200~3400	2700~2900
	5	23.31 {2.38}	17.93 {1.83}	11.96 {1.22}	4700~5000	4200~4400	3500~3700	
	6	26.76 {2.73}	20.59 {2.10}	—	4700~5000	4700~4900	—	
	8	29.94 {3.06}	23.03 {2.35}	15.39 {1.57}	5100~5400	4600~4800	3900~4100	
	10	31.23 {3.19}	24.02 {2.45}	—	5400~5700	4600~4800	3900~4100	
10	2	—	7.84 {0.80}	5.29 {0.54}	5600~5900	5000~5200	—	
	3	18.34 {1.87}	14.11 {1.44}	9.41 {0.96}	—	2000~2200	1700~1900	
	5	32.23 {3.29}	24.79 {2.53}	16.56 {1.69}	3100~3400	2800~3000	2400~2600	
	8	—	34.3 {3.50}	23.03 {2.35}	4300~4600	3800~4000	3200~3400	
	10	49.43 {5.04}	38.02 {3.88}	25.48 {2.60}	—	3800~4000	3200~3400	
12	2	—	9.02 {0.92}	5.98 {0.61}	—	4700~4900	4000~4200	
	3	—	16.46 {1.68}	11.07 {1.13}	5500~5800	4900~5100	4100~4300	
	5	—	31.16 {3.18}	20.87 {2.13}	—	1600~1800	1300~1500	
	8	—	46.55 {4.75}	31.07 {3.17}	—	2500~2700	2100~2300	
	10	—	52.72 {5.38}	35.28 {3.60}	—	3600~3800	3000~3200	
15	2	—	10.58 {1.08}	7.06 {0.72}	—	4500~4700	3800~4000	
	3	—	19.6 {2.00}	13.13 {1.34}	—	4800~5000	4000~4200	
	5	—	39.59 {4.04}	26.46 {2.70}	—	1400~1600	1100~1300	
	8	—	64.39 {6.57}	43.02 {4.39}	—	2300~2500	1900~2100	
20	3	—	34.32 {3.50}	—	—	3100~3300	2600~2800	
	5	—	75.85 {7.74}	50.67 {5.17}	—	4200~4400	3500~3700	
	10	—	98.06 {10.00}	—	—	4600~4800	3800~4000	

EAHNN
(强力钕磁铁)

EAHN
(钕磁铁)

EAHNNH
(耐热钕磁铁)

EAHMS
(钴磁铁)